




CFP2000 Result

Copyright ©1999-2004, Standard Performance Evaluation Corporation

Acer Incorporated
Altos R510 (3.6 GHz Intel Xeon)

SPECfp_rate2000 = 25.1
SPECfp_rate_base2000 = 25.1

SPEC license #: 97 Tested by: Acer Incorporated Test date: Mar-2005 Hardware Avail: Mar-2005 Software Avail: Mar-2005

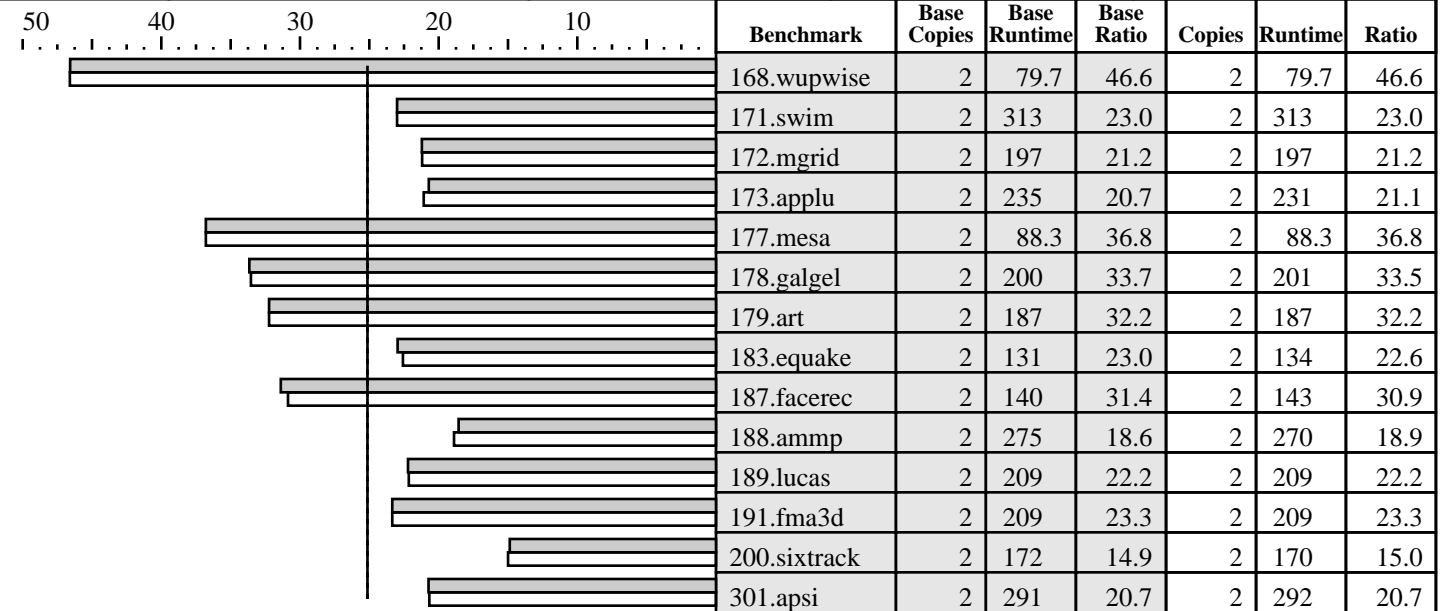

Hardware

CPU: Intel Xeon (3.6 GHz, 1MB L2, 800MHz system bus)
 CPU MHz: 3600
 FPU: Integrated
 CPU(s) enabled: 2 cores, 2 chips, 1 core/chip(Hyper-Threading Technology disabled)
 CPU(s) orderable: 1,2
 Parallel: No
 Primary Cache: 12KB(I) micro-ops + 16KB(D) on chip
 Secondary Cache: 1024KB(I+D) on chip
 L3 Cache: N/A
 Other Cache: N/A
 Memory: 6x512MB DDR-333 ECC SDRAM
 Disk Subsystem: 1 x 80GB 7200RPM SATA HDD
 Other Hardware:

Software

Operating System: Microsoft Windows Server 2003 Enterprise Edition (Build 3790)
 Compiler: Intel C++ Build 20041019Z and Fortran Compiler 8.1 Build 20040802Z
 Microsoft Visual Studio .Net 2003(7.1.3091, for libraries)
 File System: NTFS
 System State: Default

Notes/Tuning Information

```
+FDO: PASS1= -Qprof_gen PASS2=-Qprof_use
Base tuning: -fast -Qansi_alias +FDO
Portability:
178.galgel: -FI /F32000000
Peak tuning:
168.wupwise: -fast -Qansi_alias +FDO
171.swim: -fast -Qansi_alias +FDO
172.mgrid: -fast -Qansi_alias +FDO
173.applu: -fast -Qscalar_rep- -Qauto +FDO
177.mesa: basepeak=yes
178.galgel: -fast -Qansi_alias +FDO
179.art: basepeak=yes
183.quake: -QxP -Oa -Qrcd -Qipo +FDO
187.facerec: -fast -Qunroll1 -Qscalar_rep- +FDO
188.amp: -Oa -QxP
189.lucas: -fast -Qprefetch- +FDO
191.fma3d: basepeak=yes
```



CFP2000 Result

Copyright ©1999-2004, Standard Performance Evaluation Corporation

Acer Incorporated
Altos R510 (3.6 GHz Intel Xeon)

SPECfp_rate2000 = 25.1
SPECfp_rate_base2000 = 25.1

SPEC license #: 97 | Tested by: Acer Incorporated | Test date: Mar-2005 | Hardware Avail: Mar-2005 | Software Avail: Mar-2005

Notes/Tuning Information (Continued)

200.sixtrack: -Qipo -QxP +FDO
301.apsi: -fast +FDO
Enable hardware prefetching and adjacent cache line prefetch BIOS setting
Product description located as of Apr-2005:
<http://www.acer.com>